

# General Warranty

OWON warrants that the product will be free from defects in materials and workmanship for a period of 1 year from the date of purchase of the product by the original purchaser from the OWON Company. This warranty only applies to the original purchaser and is not transferable to the third party, and does not apply to fuses, disposable batteries or to any product which has been misused, altered, neglected or damaged by accident or abnormal conditions of operation or handling.

If the product proves defective during the warranty period, OWON either will repair the defective product without charge for parts and labor, or will provide a replacement in exchange for the defective product. Parts, modules and replacement products used by OWON for warranty work may be new or reconditioned like new performance. All replaced parts, modules and products become the property of OWON.

In order to obtain service under this warranty, customer must notify OWON of the defect before the expiration of the warranty period. Customer shall be responsible for packaging and shipping the defective product to the service center designated by OWON, and with a copy of customer proof of purchase.

This warranty shall not apply to any defect, failure or damage caused by improper use or improper or inadequate maintenance and care. OWON shall not be obligated to furnish service under this warranty a) to repair damage resulting from attempts by personnel other than OWON representatives to install, repair or service the product; b) to repair damage resulting from improper use or connection to incompatible equipment; c) to repair any damage or malfunction caused by the use of non-OWON supplies; or d) to service a product that has been modified or integrated with other products when the effect of such modification or integration increases the time or difficulty of servicing the product.

Please contact the nearest OWON's Sales and Service Offices for services or a complete copy of the warranty statement.

For better after-sales service, please visit [www.owon.com.cn](http://www.owon.com.cn) and register the purchased product online.

**Excepting the after-sales services provided in this summary or the applicable warranty statements, OWON will not offer any guarantee for maintenance definitely declared or hinted, including but not limited to the implied guarantee for marketability and special-purpose acceptability. OWON should not take any responsibilities for any indirect, special or consequent damages.**

For more details, please refer to the user manual, it can be downloaded at [www.owon.com.cn](http://www.owon.com.cn).

# 1. Safety Information


## Safety Considerations

**Before any operations, please read the following safety precautions to avoid any possible bodily injury and prevent damage to this product or any other products connected. To avoid any contingent danger, use this product only as specified.**

- Limit operation to the specified measurement category, voltage, or amperage ratings.
- **Do not use the multimeter if it is damaged.** Before you use the multimeter, inspect the case. Look for cracks or missing plastic. Pay particular attention to the insulation surrounding the connectors.
- **Do not use the test leads provided for other products.** Use only the certified test leads specified for this product.
- Inspect the test leads for damaged insulation or exposed metal.
- Before use, verify the multimeter's operation by measuring a known voltage.
- Only the qualified technicians can implement the maintenance.
- **Always use the specified battery type.** The power for the multimeter is supplied with two standard AA 1.5 V batteries. Observe the correct polarity markings before you insert the batteries to ensure proper insertion of the batteries in the multimeter.
- **Check all Terminal Ratings.** To avoid fire or shock hazard, check all ratings and markers of this product. Refer to the user's manual for more information about ratings before connecting to the multimeter.
- Do not operate the multimeter with the cover or portions of the cover removed or loosened.
- **Use Proper Fuse.** Use only the specified type and rating fuse for the multimeter.
- **Do not operate if in any doubt.** If you suspect damage occurs to the multimeter, have it inspected by qualified service personnel before further operations.
- **To avoid electric shock, do not operate this product in wet or damp conditions.**
- **Do not operate in an explosive atmosphere.**
- **Keep product surfaces clean and dry.**
- Do not apply more than the rated voltage (as marked on the multimeter) between terminals, or between terminal and earth ground.

## 1.Safety Information

---

- When measuring current, turn off the circuit power before connecting the multimeter in the circuit. Remember to place the multimeter in series with the circuit.
- When servicing the multimeter, use only the specified replacement parts.
- Use caution when working above 60 V DC, 30 V AC RMS, or 42.4 V peak. Such voltages pose a shock hazard.
- When using the test leads, keep your fingers behind the finger guards on the test leads.
- Remove the test leads from the multimeter before you open the battery cover.
- To avoid false readings, which may lead to possible electric shock or personal injury, replace the battery as soon as the low battery indicator  appears and flashes.
- Disconnect circuit power and discharge all high-voltage capacitors before testing resistance, continuity, diodes, or capacitance.
- **Use the proper terminals, function, and range for your measurements.** When the range of the value to be measured is unknown, set the rotary switch position as the highest range, choose the auto ranging mode. To avoid damages to the multimeter, do not exceed the maximum limits of the input values shown in the technical specification tables.
- Connect the common test lead before you connect the live test lead. When you disconnect the leads, disconnect the live test lead first.
- Before changing functions, disconnect the test leads from the circuit under test.

## Measurement Category

The multimeter has a safety rating of 1000 V, CAT III.

## Safety Terms and Symbols

### Safety Terms

**Terms in this Manual.** The following terms may appear in this manual:



**Warning:** Warning indicates the conditions or practices that could result in personal injury or death.



**Caution:** Caution indicates the conditions or practices that could result in damage to this product or other property.

**Terms on the Product.** The following terms may appear on this product:

**Danger:** It indicates an injury or hazard may immediately happen.

**Warning:** It indicates an injury or hazard may be accessible potentially.

**Caution:** It indicates a potential damage to the instrument or other property might occur.


### Safety Symbols

**Symbols on the Product.** The following symbol may appear on the product:

	Direct current (DC)		Fuse
	Alternating current (AC)		Caution, risk of danger (refer to this manual for specific Warning or Caution information)
	Both direct and alternating current	<b>CAT II</b>	Category II overvoltage protection
	Ground terminal	<b>CAT III</b>	Category III overvoltage protection
	Conforms to European Union directives	<b>CAT IV</b>	Category IV overvoltage protection
	Equipment protected throughout by double insulation or reinforced insulation		

## 2. Multimeter in Brief

### Front panel

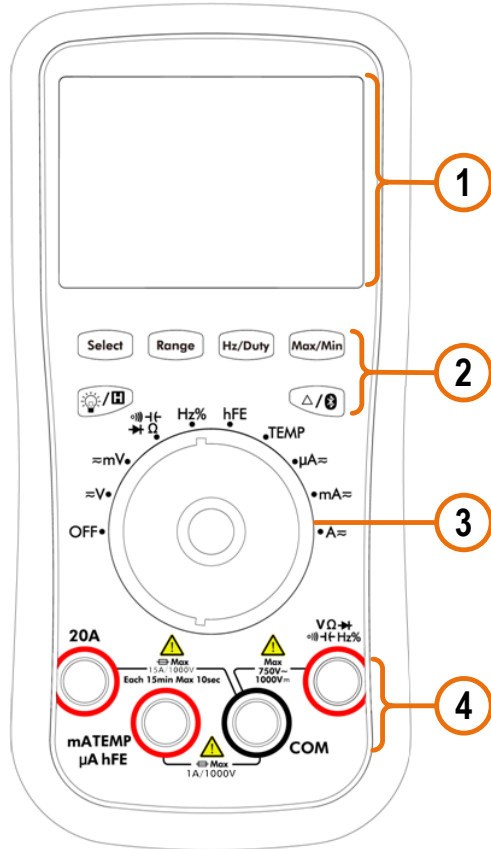

No.	Description
①	Display screen
②	Keypad
③	Rotary switch
④	Input terminals

Figure 2-1 Front panel overview (B35 shown)







### Rotary switch

Position	Description
OFF	Power off
$\approx V$	DC or AC voltage measurement
$\approx mV$	DC or AC voltage measurement (up to 600 millivolts)
$\rightarrow \Omega$	Continuity test
$\rightarrow \Omega$	Capacitance measurement
	Diode test

## 2.Multimeter in Brief

	Resistance measurement
Hz%	Frequency measurement
hFE	Transistor measurement — Not available on B41T(+)
TEMP	Temperature measurement
$\mu\text{A}\approx$	DC or AC current measurement (up to 600 microamperes)
$\text{mA}\approx$	DC or AC current measurement (up to 600 milliamperes)
$\text{A}\approx$	DC or AC current measurement

## Keypad

Key	Description
	<p>Select function:</p> <ul style="list-style-type: none"> <li>• Select DC or AC</li> <li>• Select °C or °F during temperature measurements</li> <li>• Select Resistance/Diode/Continuity/Capacitance</li> </ul> <p>Note: Select Resistance/Diode/Continuity on B41T(+).</p>
	Auto/Manual range
	Select frequency/duty cycle
	Capturing Max. and Min. Values
	<p>Backlight</p> <p>Data Hold</p>
	<p>Relative Measurements</p> <p>Bluetooth (only for the model with Bluetooth)</p>

## Display screen

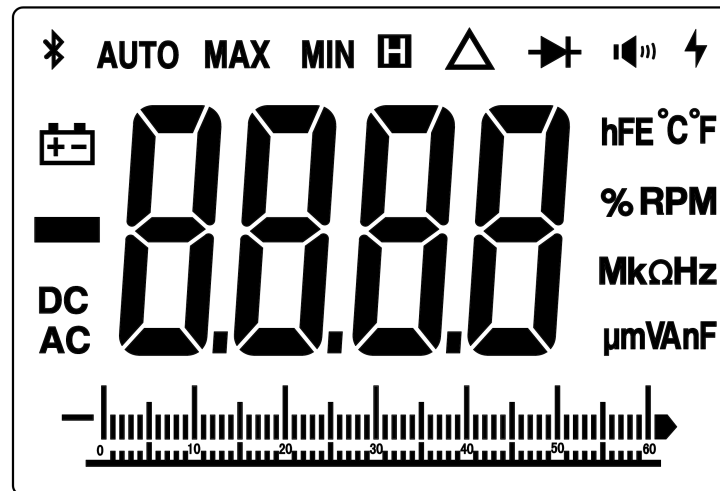


Figure 2-2 Display screen

Symbol	Description
⌘	Bluetooth enabled
<b>AUTO</b>	Auto range
<b>MAX</b>	Maximum reading
<b>MIN</b>	Minimum reading
□	Data hold enabled
△	Relative enabled
➤	Diode test selected
🔊	Continuity test selected
⊕-⊖	Battery is low
<b>DC</b>	DC

<b>AC</b>	AC
	Measurement display ("OL" is short for overload, indicates the reading exceeds the display range)
hFE °C °F % RPM MkΩ Hz μmV AnF	Measuring units
	Analog bar graph

## Input terminals

The terminal connections for the different measurement functions of the multimeter are described in the table below.



**Warning:** Before starting any measurement, observe the rotary switch position of the multimeter, and then connect the test leads to the correct terminals.



**Caution:** To avoid damaging the multimeter, do not exceed the rated input limit.

## Input terminals on 35 series multimeter

Rotary switch position	Input terminals	Overload protection
$\approx V$	$V \Omega \rightarrow$ $\rightarrow \Omega \rightarrow$ Hz%	<b>COM</b> 750 VAC/1000 VDC
$\approx mV$	$V \Omega \rightarrow$ $\rightarrow \Omega \rightarrow$ Hz%	<b>COM</b> 250 VDC or Equivalent voltage RMS
$\rightarrow \Omega$	$V \Omega \rightarrow$ $\rightarrow \Omega \rightarrow$ Hz%	<b>COM</b> 250 VAC or Equivalent voltage RMS
Hz%	$V \Omega \rightarrow$ $\rightarrow \Omega \rightarrow$ Hz%	<b>COM</b> 250 VAC or Equivalent voltage RMS



## 2.Multimeter in Brief

hFE	mA TEMP μA hFE	COM	1A/250V, fast-acting fuse
TEMP	mA TEMP μA hFE	COM	
μA≈	mA TEMP μA hFE	COM	
mA≈	mA TEMP μA hFE	COM	
A≈	20A	COM	20A/250V, fast-acting fuse

### Input terminals on B41T(+)

Rotary switch position	Input terminals	Overload protection
≈V	V Ω → ◊)) ← Hz%	COM 750 VAC/1000 VDC
≈mV	V Ω → ◊)) ← Hz%	COM 250 VDC or Equivalent voltage RMS
◊)) → Ω	V Ω → ◊)) ← Hz%	COM 250 VAC or Equivalent voltage RMS
Hz%	V Ω → ◊)) ← Hz%	COM 250 VDC or Equivalent voltage RMS
←	V Ω → ◊)) ← Hz%	COM 250 VDC or Equivalent voltage RMS
TEMP	mA μA TEMP	COM
μA≈	mA μA TEMP	COM 1A/250V, fast-acting fuse
mA≈	mA μA TEMP	COM
A≈	20A	COM 20A/250V, fast-acting fuse


## 3. Multimeter Features

### Sleep Mode

The multimeter automatically enters the sleep mode if the rotary switch is not moved or a key is not pressed for 15 minutes. (When the Bluetooth is activated, this function is disabled.)


Pressing any key will turn the multimeter back to operation mode from the sleep mode.

One minute before Auto Power-off, the buzzer will beep five times to warn. Before shutoff, the buzzer will emit a long beep, and then the multimeter will shut off.



To disable the Auto Power-off function, hold down  while powering on the multimeter, the multimeter will not shut off automatically.

**Note:** In sleep mode, the multimeter will still consume a little power. If the multimeter is not going to be used for a long period, the power should be turned off.

### Backlight Control

To view the display in low-light conditions, you can activate the LCD backlight by pressing  for more than 2 seconds. The backlight will last for one minute.

### Data Hold Mode


(1) Press  to freeze the display during measurement,  will be shown on the display.


(2) Press  again to exit this mode.

**Note:** This function is not available when measuring diodes and transistor.

## Capturing Max. and Min. Values

In MAX mode, the measured maximum value will be held; In MIN mode, the measured minimum value will be held.

(1) Press  to cycle between the MAX mode and MIN mode.

(2) Press  for more than 2 seconds to exit the mode.


In this mode, the manual range mode will be activated automatically. Analog bar graph is not displayed. Auto power-off function is disabled.

**Note:** This function is not available when measuring diodes, capacitance, transistor, and frequency.

## Making Relative Measurements

When making relative measurements, reading is the difference between a stored reference value and the input signal.

(1) Press  to enter the relative mode.

The measurement value when pressing  is stored as the reference value.

In this mode,  $REL\Delta$  (current reading) = input value - reference value.

(2) Press it again to exit the mode.

In relative measurement, the manual range mode will be activated automatically. (The relative measurement should be carried out under a certain range, that is, this function is only available under the manual range mode.) Analog bar graph is not displayed.

**Note:** This function is not available when measuring diodes, transistor, and frequency.

## Buzzer Feature

- Press the function key, the buzzer emits a short beep.
- One minute before Auto Power-off, the buzzer will beep five times to



#### 4. Bluetooth Function –only for the model with Bluetooth


warn. Before shutoff, the buzzer will emit a long beep, and then the multimeter will shut off.

- The buzzer beeps continuously to warn once the measured DC voltage exceeds 1000 V, AC voltage exceeds 750 V, or the voltage in DC/AC mV mode exceeds 600.0 mV.
- The buzzer emits a long beep when the short circuit resistance is less than about  $30\Omega$  during the continuity test.
- When the Bluetooth function is idle for 10 minutes, the Bluetooth will be turned off automatically. Before turning off, the buzzer will beep twice.

## 4. Bluetooth Function –only for the model with Bluetooth

### How to Connect with Android Device


- (1) Install the free application software for Android on your Android smart device.
- (2) Launch the "Multimeter" application.
- (3) Turn on the multimeter, press and hold  until  appear on the display.
- (4) Click the icon on the top left of the screen to launch device connection.

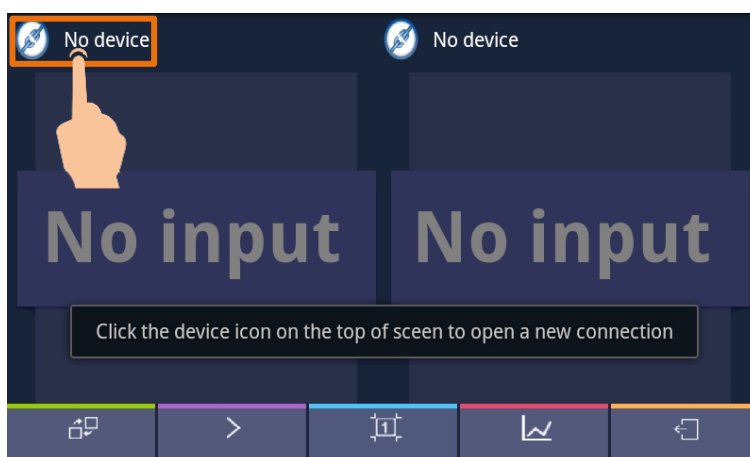


- (5) If the Bluetooth function is not activated, a dialog box will ask whether to turn on Bluetooth. Click "Yes".

#### 4. Bluetooth Function –only for the model with Bluetooth


---

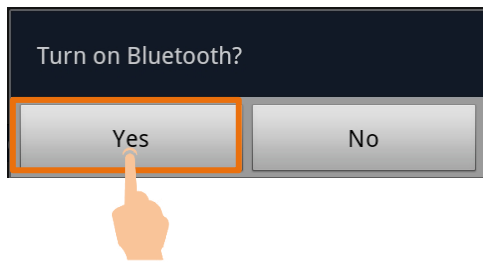

Click to scan for Bluetooth devices.

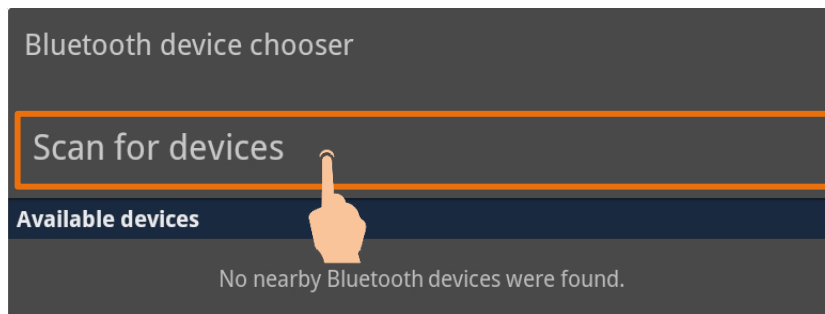

(6) Click "BDM" in the device list to pair.

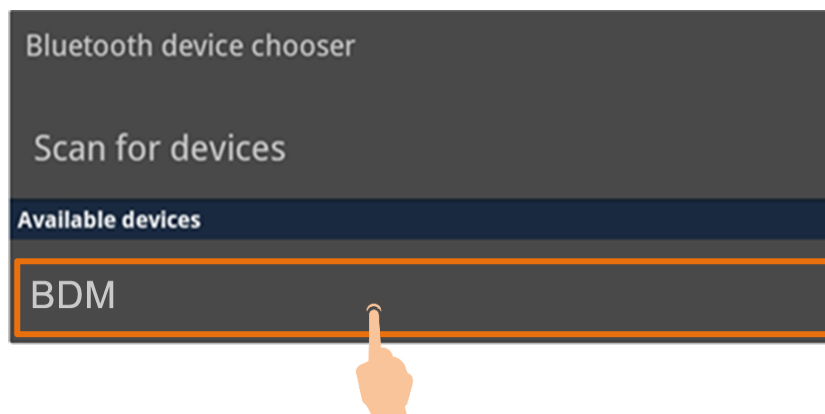


### How to Connect with iOS Device

(1) Install the free application software for iOS on your iOS smart device.






(2) Launch the application .If the Bluetooth function is not activated, a dialog box will prompt you to turn on Bluetooth. Tap on "Settings".

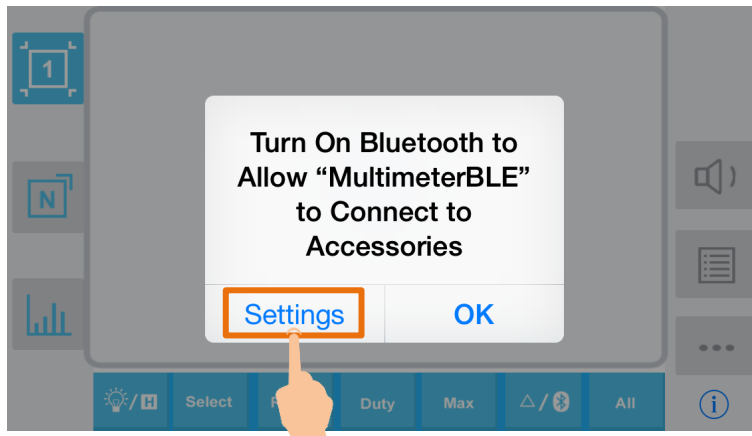
#### 4. Bluetooth Function –only for the model with Bluetooth

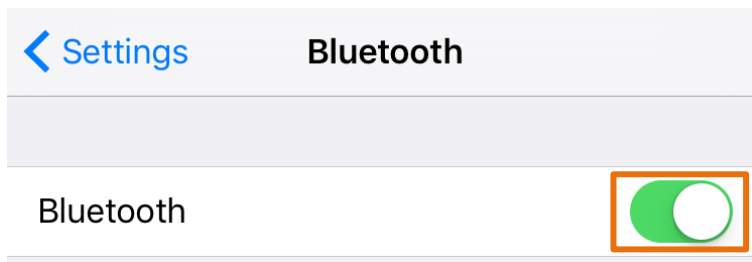

Turn on Bluetooth, and return to the multimeter APP.




- (3) Turn on the multimeter, press and hold  until  appear on the display.
- (4) Tap on the center to launch device connection.

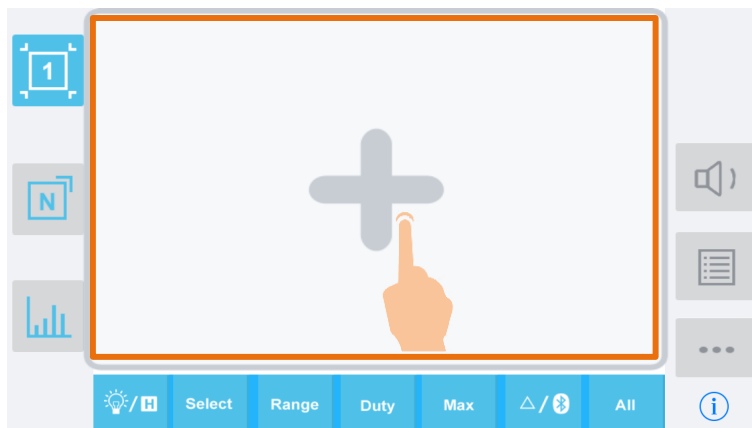

- (5) Select the desired multimeter in the device list.

#### 4. Bluetooth Function –only for the model with Bluetooth

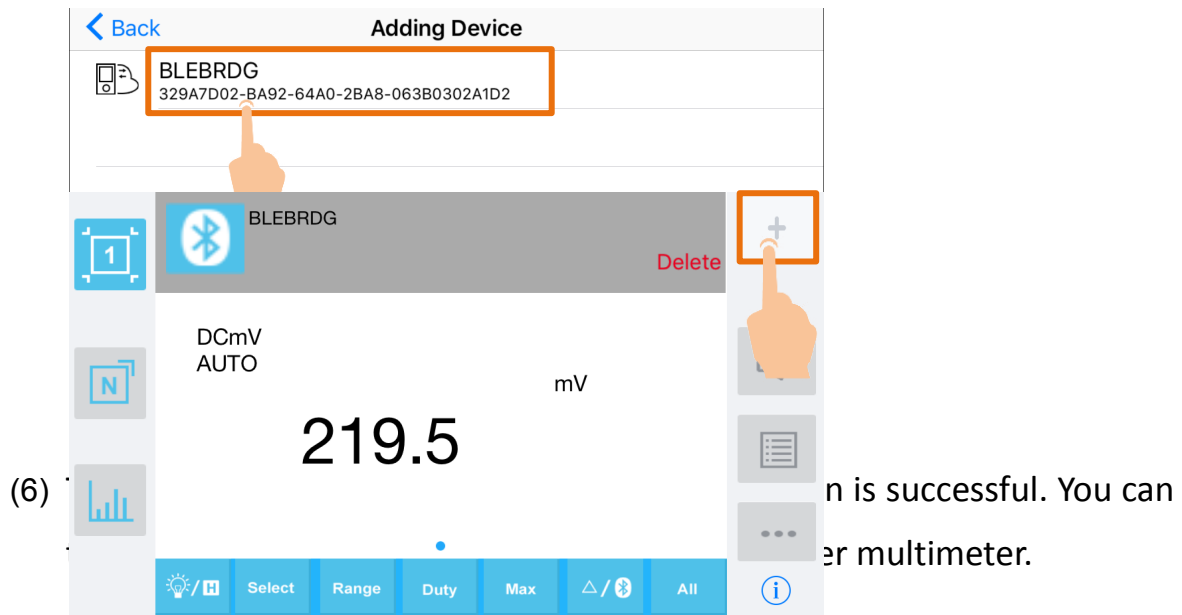

#### How to Connect with Computer – only for B35(T)+ or B41T(+)

To connect the multimeter to a computer, a **Bluetooth USB dongle** should be plugged into the USB port of computer.

- Use only the Bluetooth USB dongle (optional) supplied with the product.
- The computer must be running the **Windows** operating system (Windows 10, Windows 8, Windows 7, Windows Vista, Windows XP).


##### Step 1: Install multimeterBLE software

Install the multimeterBLE software on your computer.

##### Step 2: Install driver of Bluetooth USB dongle


- (1) Navigate to the multimeterBLE software installation folder (for example, C:\Program Files\multimeterBLE).

Double-click **BLE-CC254x-1.4.1.43908.exe** in this folder.

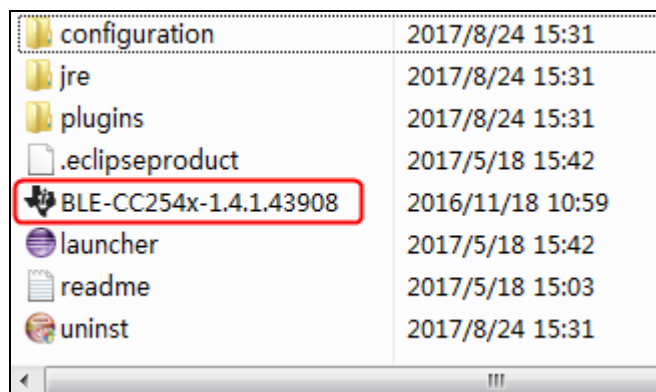


#### 4. Bluetooth Function –only for the model with Bluetooth

(2) Click **"Next"**.

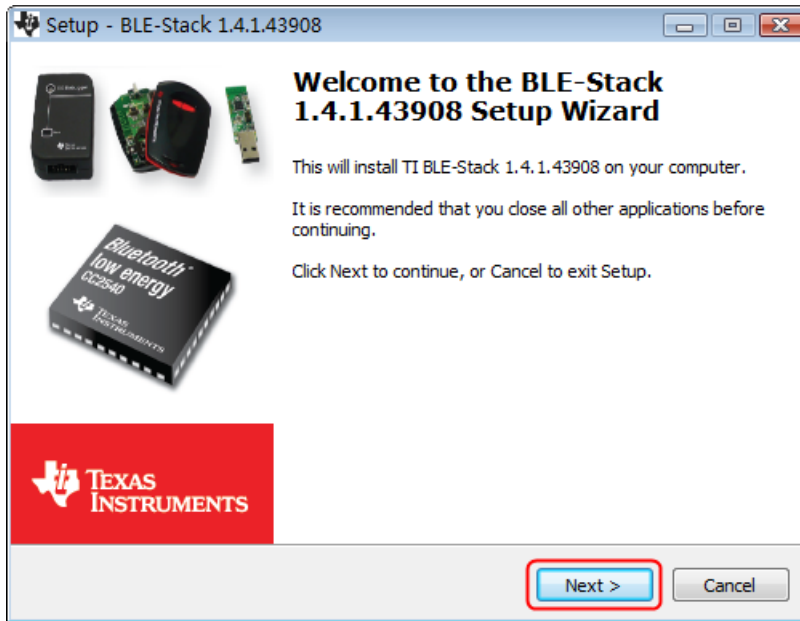

(3) Select **"I accept the agreement"**, and then click **"Next"**.

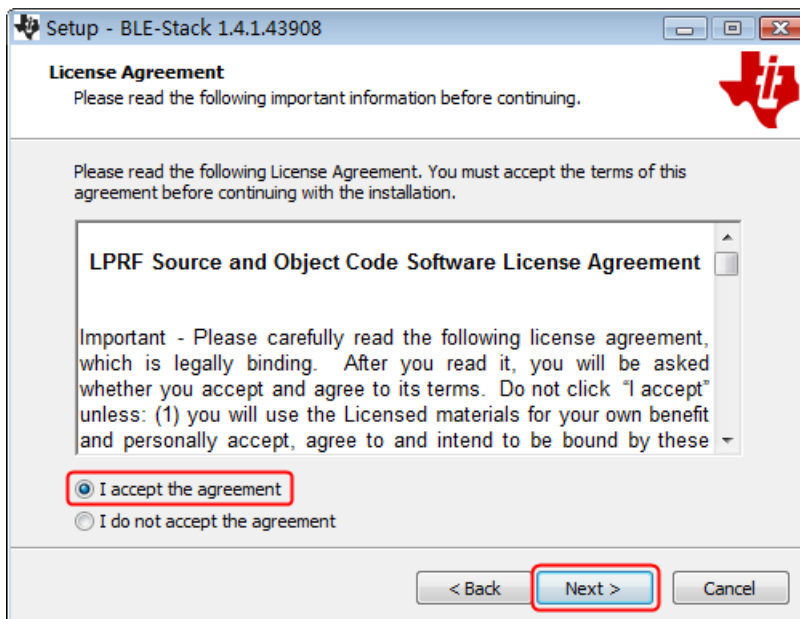





#### 4. Bluetooth Function –only for the model with Bluetooth

---


(4) Select the destination folder, and then click **"Next"**.

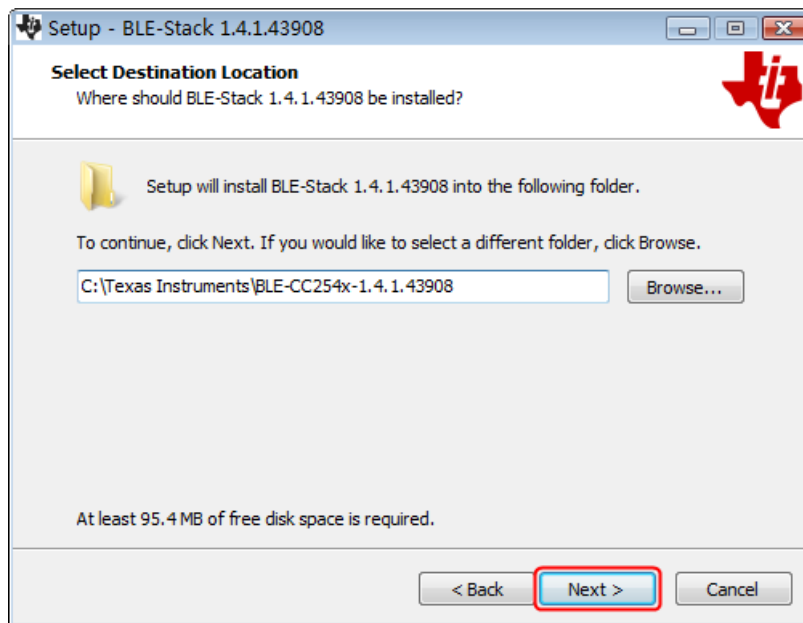


(5) Click **"Install"**.

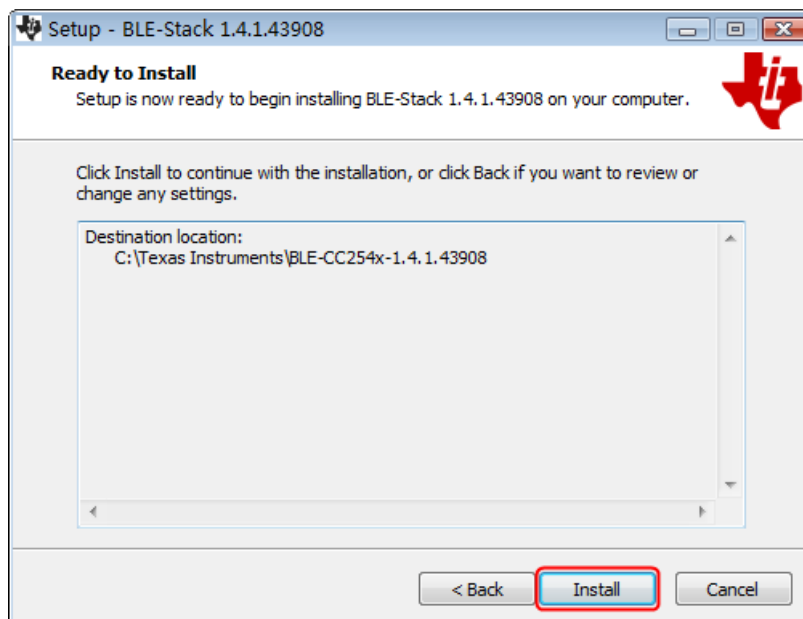

#### 4. Bluetooth Function –only for the model with Bluetooth

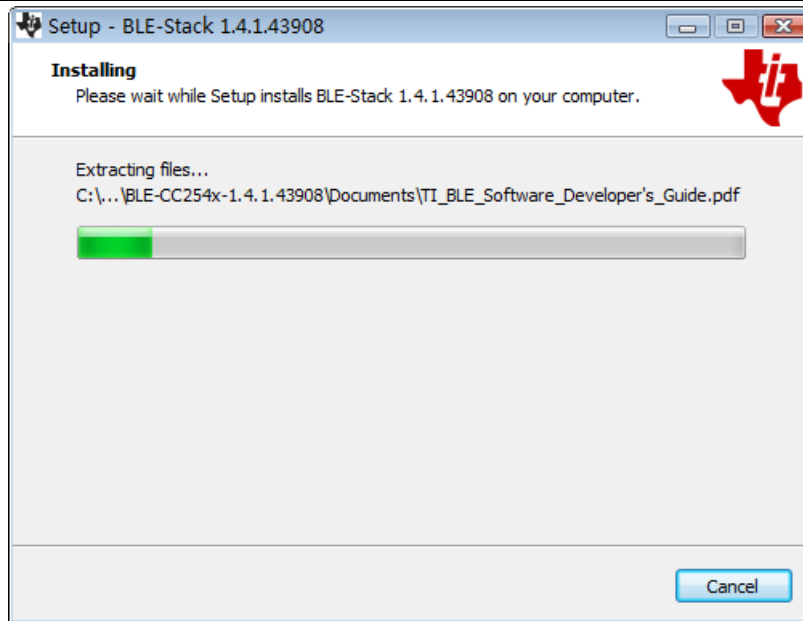

(6) Uncheck "**View the Release Notes**", and click "**Finish**" to exit Setup.

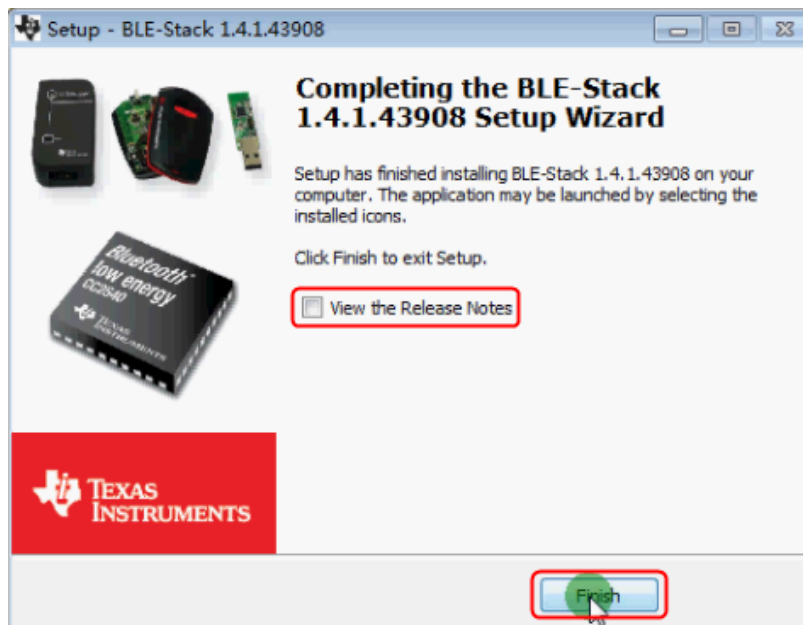

(7) Plug the Bluetooth USB dongle into a USB port on your computer.

Right click [**Computer**], you can find it on the desktop, or in [**Start**] menu. In the drop down menu, click on [**Manage**], the “Computer Management” window opens.




#### 4. Bluetooth Function –only for the model with Bluetooth

Click on **"Device Manager"** on the left hand side. On the right hand side, double click on **"Ports (COM & LPT)"**.


Under ports, if **"TI CC2540 USB CDC Serial Port (COM#)"** is displayed, that means the driver is installed successfully. Remember the **"COM #"** because you will need to configure the multimeterBLE software.

**Note:** If an unknown device is displayed, try to install the driver manually following the steps below.

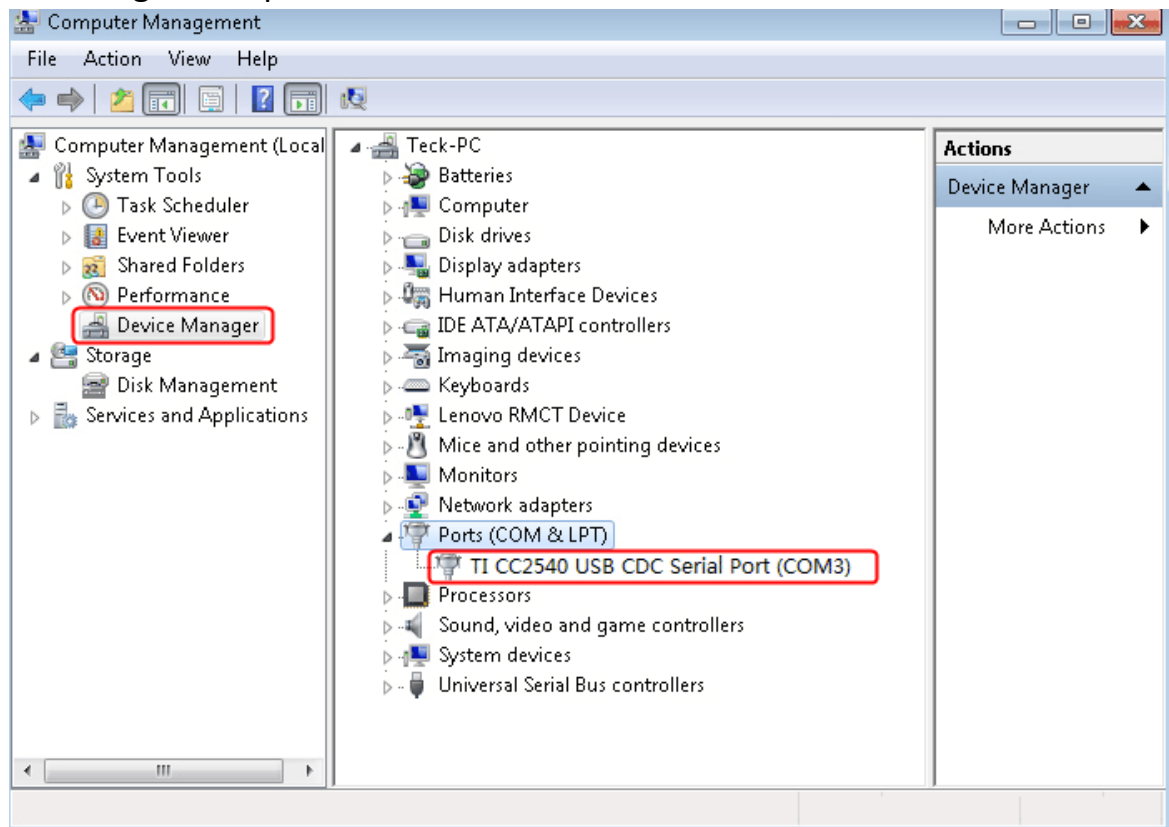


#### How to install the driver manually

Right click the unknown device icon, in the drop down menu, click **"Update Driver Software..."**.

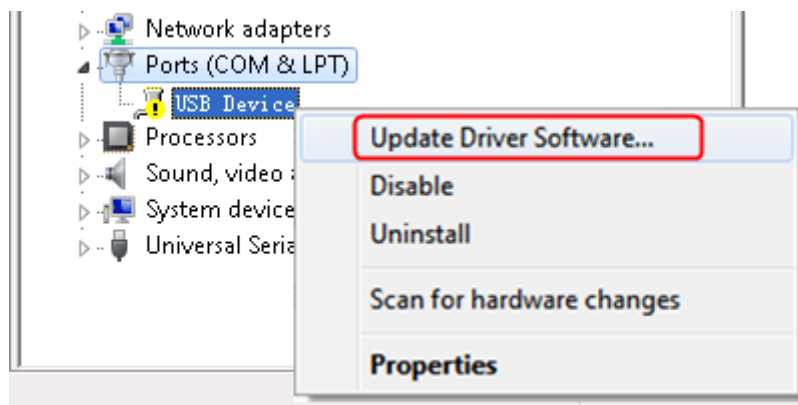


#### 4. Bluetooth Function –only for the model with Bluetooth

Select "**Browse my computer for driver software**".

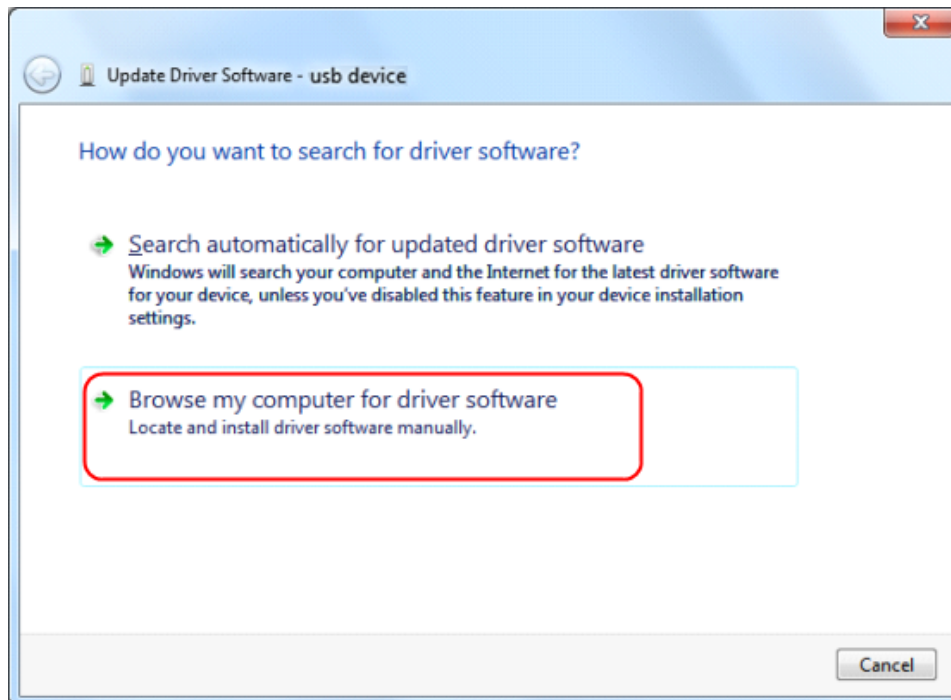


Select a directory path for the driver, and click "**Next**".

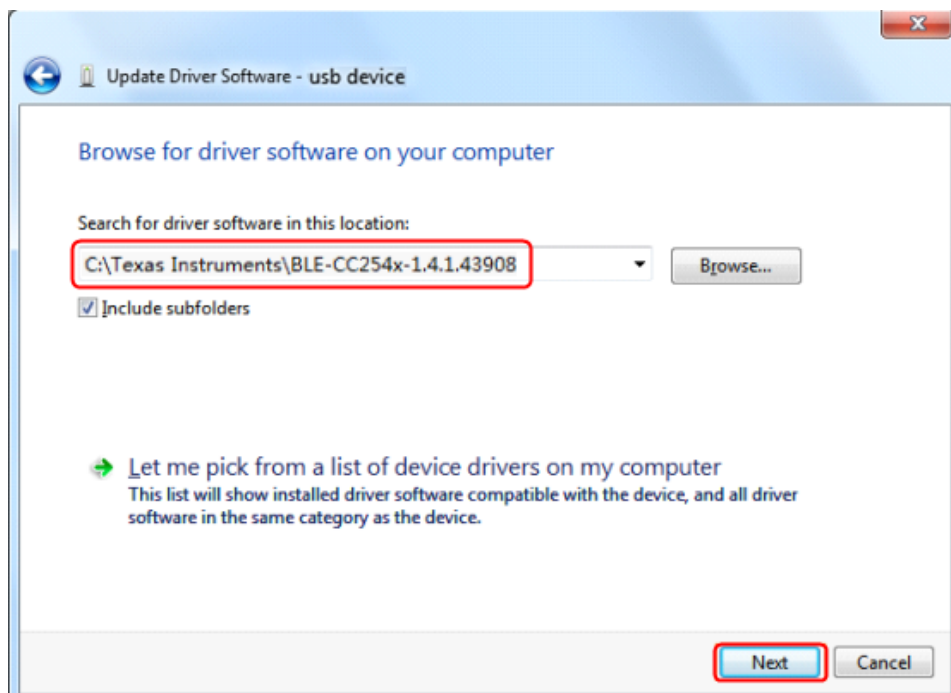

After installing successfully, click "**Close**".

In Device Manager, check if "**TI CC2540 USB CDC Serial Port (COM#)**" is displayed under Ports (COM & LPT).

#### 4. Bluetooth Function –only for the model with Bluetooth

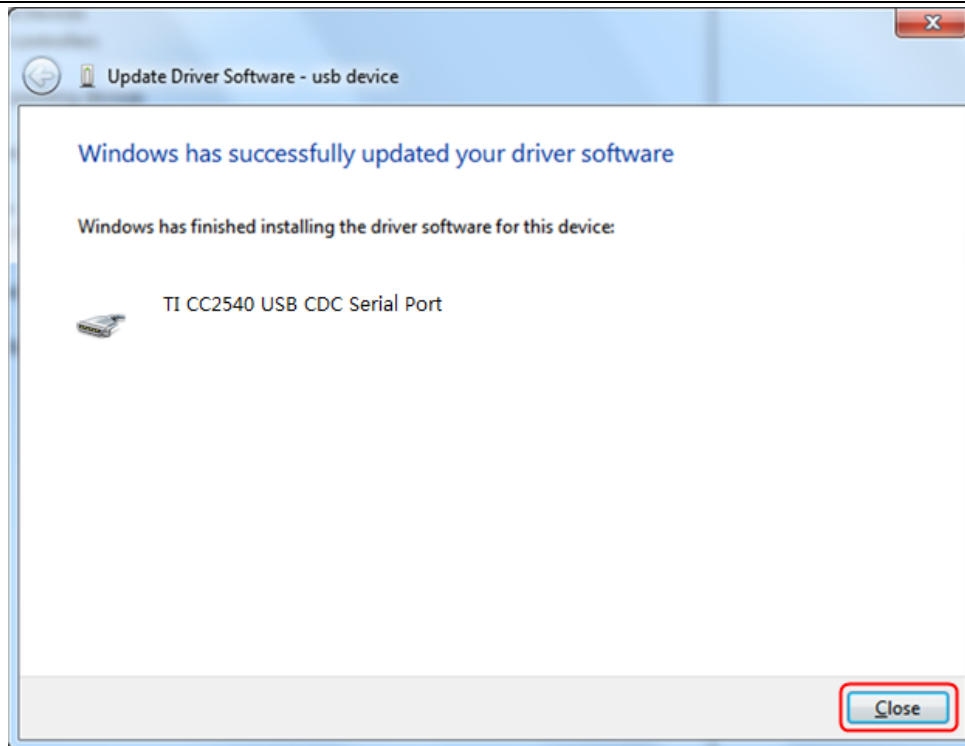


### Step 3: Connect to multimeterBLE software



- (1) After installing the Bluetooth USB dongle driver successfully, run the multimeterBLE software, the configure dialog box appears.

Make sure that the Bluetooth USB dongle is plugged into the computer.


To find the "Port" (COM #), you will need to look for it under "Ports (COM & LPT)" in Device Manager window.

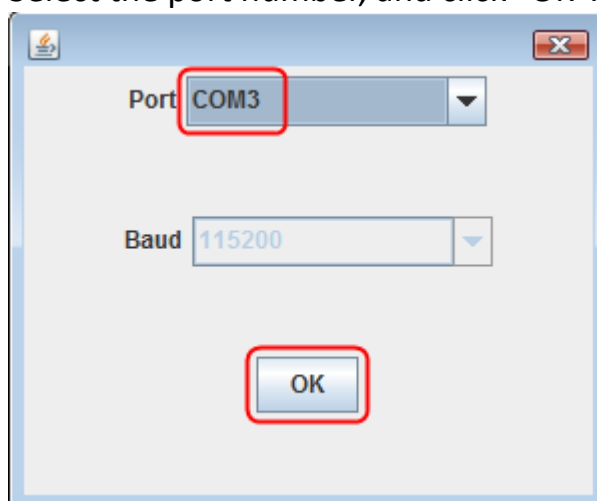
Select the port number, and click "OK".




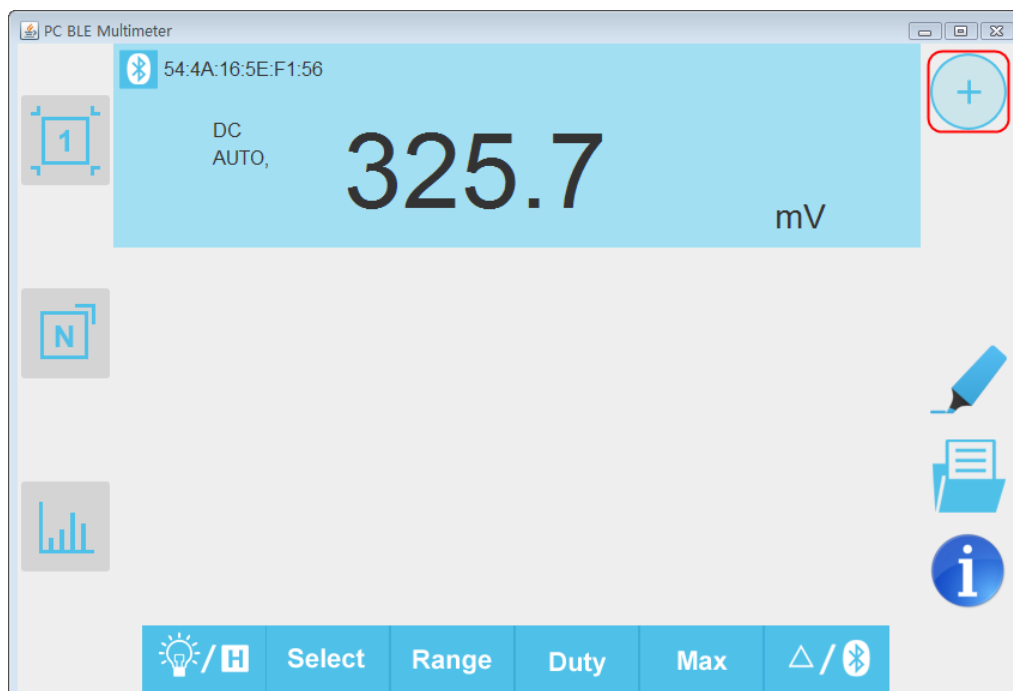
- (2) Turn on the multimeter, press and hold  until  appear on the display.

#### 4. Bluetooth Function –only for the model with Bluetooth

- (3) Click  softkey on the right, a Scan Devices dialog box appears. A progress bar shows the progress of scanning multimeters. It will take a few seconds. When the scan is finished, select the desired multimeter in the device list. Click the "**Connect**" button.

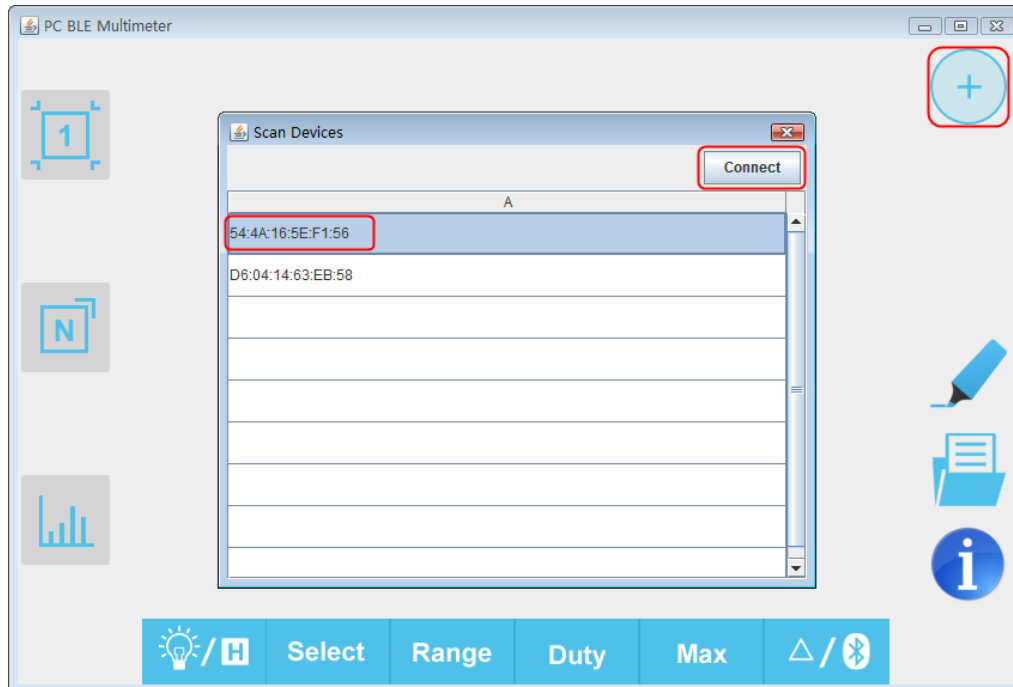


- (4) The measurements will be shown if the connection is successful. You can tap on the  softkey on the right to add another multimeter.




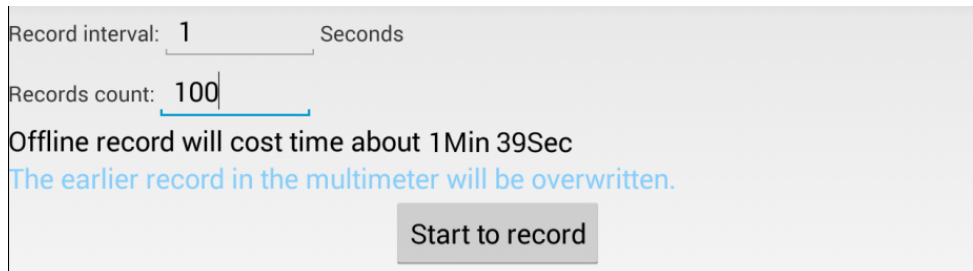
## 5. Multimeter Offline Record – the "+" model only

When measuring using the multimeter with offline record function, you can use Android/iOS device APP or PC software to send a command, the multimeter will start recording the measurements. After receiving the command, the connection will be disconnected automatically. The multimeter will record the measuring data in its own memory. After completion of the record, use APP or PC software to reconnect the multimeter, and then you can read the measuring data into the device as a CSV file. You can use this function to record for a long time without staff on duty, while reducing Bluetooth consumption to conserve the battery power of the multimeter.

**Note:** When the low battery indicator  appears on the meter screen, the offline record function may not work correctly. Please check the batteries of the meter to ensure them in a good state.

### Offline Record for Android Device

- (1) Connect the Android device with the multimeter, see "*How to Connect with Android Device*" on P11.
- (2) In APP single view, tap on the  icon on the top right, select **Record setting** from the pop-up menu.



Record interval:  Seconds

Records count:

Offline record will cost time about 1Min 39Sec

The earlier record in the multimeter will be overwritten.

**Start to record**

- (3) Set "Record interval" and "Records count" (maximum records count is 10,000). Tap on **Start to record**. The memory in the multimeter can only store the recording data of one time. When start to record, the earlier offline record stored in the multimeter will be overwritten.
- (4) After starting, in two seconds, the APP interface will display



The record command has been sent to the multimeter, Bluetooth connection will be disconnected in two seconds.




## 5.Multimeter Offline Record – the "+" model only


The Android device will disconnect with the multimeter in two seconds. After disconnecting, the Bluetooth of the multimeter is in low-power state. The information will be shown on APP:

Bluetooth connection has been disconnected. To read the record, enable the Bluetooth and reconnect. The Bluetooth symbol on the meter screen will disappear after completion of the record.

The multimeter will record the current measurements and store in the memory. After completion of the record, the Bluetooth of the multimeter will be disabled automatically, and the Bluetooth symbol on the multimeter screen will disappear.

**Note:** If the multimeter is in the process of recording data and not finished yet, the APP can not connect with the multimeter. If you want to interrupt the recording process of the multimeter, press and hold  until  disappear on the display, or turn the multimeter off.


- (5) After completion of the record, to read the measuring data, press and hold  until  appear on the display. Reconnect the Android device and the multimeter.
- (6) In APP single view, tap on the  icon on the top right, select **Record read** from the pop-up menu.

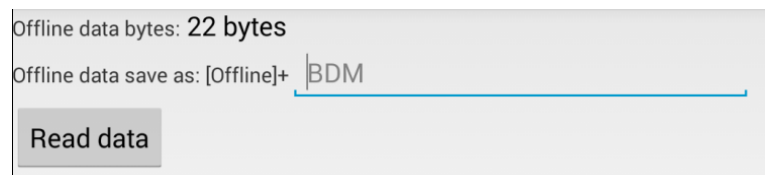

The file name start with "Offline", the following part can be customized.

- (7) Tap on **Read data**, APP will read the measuring data and save as a CSV file into the Android device.


After reading, display as below:

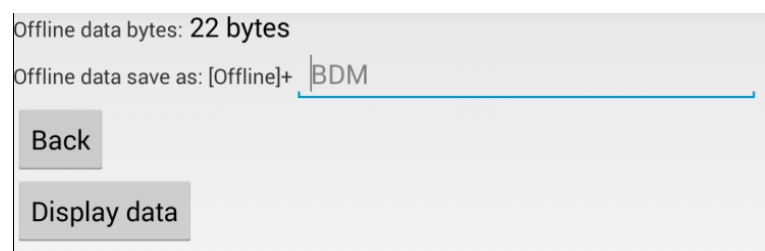

- (8) Tap on **Display data**, the data will be displayed in Data Graph and Table interface.



## Offline Record for iOS Device

- (1) Connect the iOS device with the multimeter, see "*How to Connect with iOS Device*" on P12.
- (2) In APP device view, tap on the  softkey on the right, select "**Record setting**" from the pop-up menu.

Tips:The earlier record in the multimeter will be overwritten.



Record interval \_Sec




Record counts  Maximum is 10,000

Record will cost time about: 9Sec


[start offline record](#)

- (3) Set "Record interval" and "Records counts" (maximum records count is 10,000). Tap on "**start offline record**". The memory in the multimeter can only store the recording data of one time. When start to record, the earlier offline record stored in the multimeter will be overwritten. After completion of the record, the Bluetooth of the multimeter will be disabled automatically, and the Bluetooth symbol on the multimeter screen will disappear.

**Note:** If the multimeter is in the process of recording data and not finished yet, the APP can not connect with the multimeter. If you want to interrupt the recording process of the multimeter, press and hold  until  disappear on the display, or turn the multimeter off.

- (4) After completion of the record, to read the measuring data, press and hold  until  appear on the display. Reconnect the iOS device and the multimeter.
- (5) In APP device view, tap on the  softkey on the right, select "**Record read**" from the pop-up menu.

## 5.Multimeter Offline Record – the "+" model only

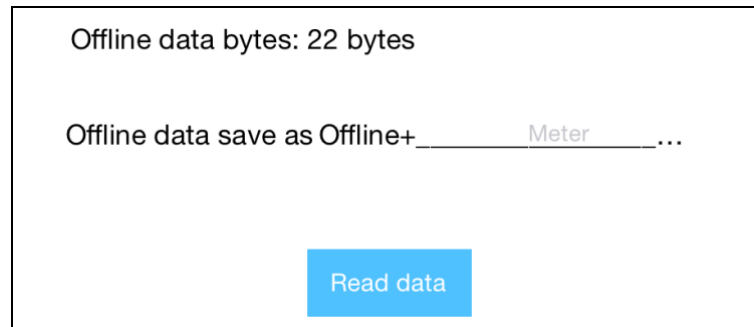

Offline data bytes: 22 bytes


Offline data save as Offline+         Meter        ...

Read data

The file name start with "Offline", the following part can be customized.

- (6) Tap on "**Read data**", APP will read the measuring data and save as a CSV file into the iOS device.

After reading, display as below:

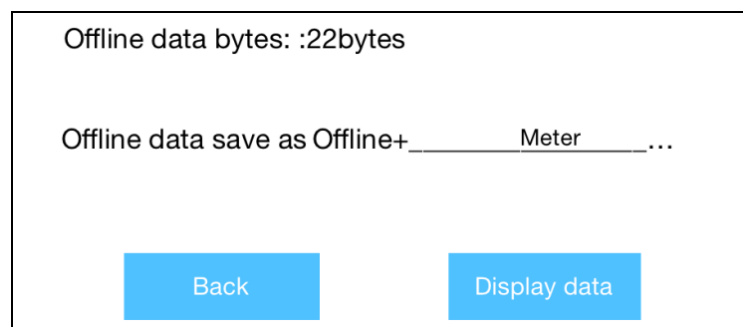


Offline data bytes: :22bytes


Offline data save as Offline+         Meter        ...

Back      Display data

- (7) Tap on "**Display data**", the data will be displayed in Data Graph and Table interface.

## Offline Record for PC Software

- (1) Connect the multimeterBLE software with the multimeter, see "*How to Connect with Computer*" on P14.
- (2) On software interface, click the  softkey on the right, a dialog will show.

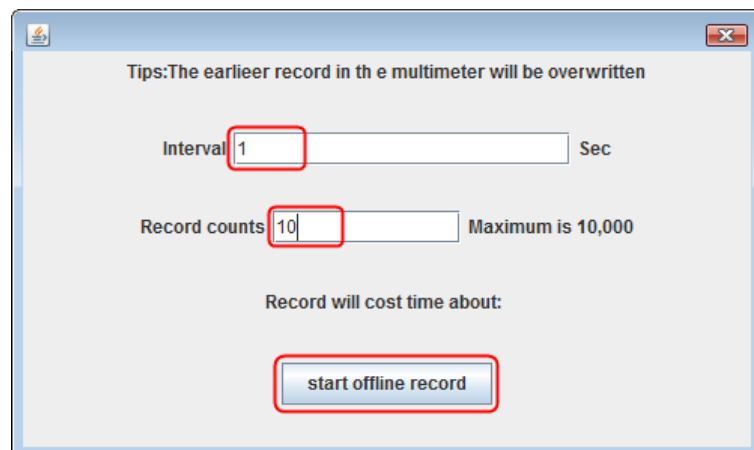

Tips:The earlier record in the multimeter will be overwritten

Interval 1 Sec

Record counts 10 Maximum is 10,000



Record will cost time about:




start offline record


- (3) Set "Interval" and "Record counts" (maximum records count is 10,000).

## 5.Multimeter Offline Record – the "+" model only


Click "**start offline record**". The memory in the multimeter can only store the recording data of one time. When start to record, the earlier offline record stored in the multimeter will be overwritten. After completion of the record, the Bluetooth of the multimeter will be disabled automatically, and the Bluetooth symbol on the multimeter screen will disappear.

**Note:** If the multimeter is in the process of recording data and not finished yet, the APP can not connect with the multimeter. If you want to interrupt the recording process of the multimeter, press and hold  until  disappear on the display, or turn the multimeter off.

- (4) After completion of the record, to read the measuring data, press and hold  until  appear on the display. Reconnect the software and the multimeter.
- (5) On software interface, click  softkey on the right, a dialog will show. The file name start with "Offline", the following part can be customized.

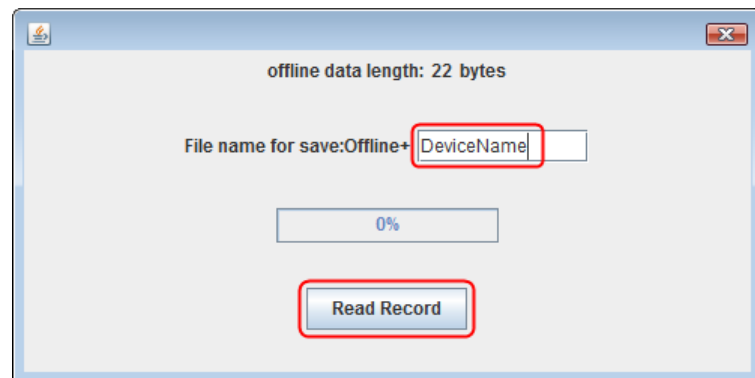

- (6) Click "**Read Record**", the software will read the measuring data and save as a CSV file into computer. After reading, the dialog is as below:

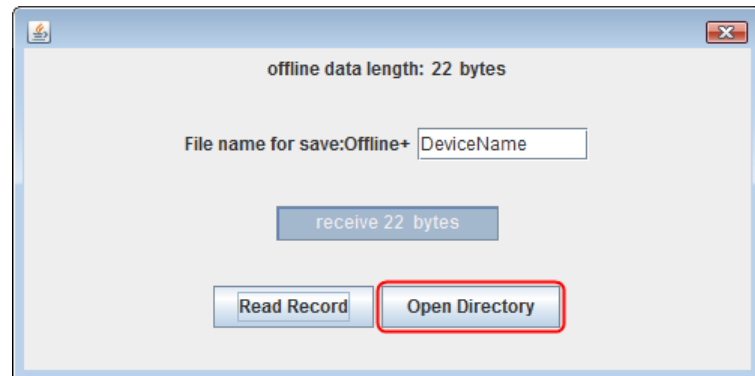

- (7) Click "**Open Directory**" to open the directory where the CSV files are saved.

## 6. Appendix

### Appendix A: Enclosure

#### Standard Accessories:



**Test lead**



**Crocodile clip**



**Multi-functional  
test socket**  
(Not available for  
B41T(+))



**K-type  
thermocouple**



**Quick Guide**



**Soft Bag**

#### Options:



**Thin-tipped test lead**



**Bluetooth USB dongle**

## Appendix B: General Care and Cleaning



**Warning:** To avoid electrical shock or damage to the multimeter, ensure that the insides of the casing stay dry at all times.

---

### Cleaning

To clean the instrument exterior, perform the following steps:

Wipe the dust from the instrument surface with a soft cloth. Do not make any scuffing on the screen when clean the LCD. Clean the instrument with a wet soft cloth not dripping water. It is recommended to scrub with soft detergent or fresh water. To avoid damage to the instrument, do not use any corrosive chemical cleaning agent.

Dirt or moisture in the terminals can distort readings. Follow the steps below to clean your multimeter.

1. Turn the multimeter off and remove the test leads.
2. Turn the multimeter over and shake out the dirt in the terminals.
3. Wipe the contacts in each terminal with a clean swab dipped in alcohol.

2018.02 V1.6.2